Avolites Ltd. Engineering Change Notice

Title Diamond 4 CPU fan bracket

ECN Number ECN-0159

Equipment Diamond 4 Vision and Elite

AuthorJ.B.TobyDrawing NumberNADate01/04/05

Reason for ECN Rough console handling can shear off processor mount

Special Parts required 1364-0040AA bracket, only for production

32-02-9009 as retrofit kit

Special Tools required None

Work Required

Switch off the console.

Open the console and locate the PC motherboard

Identify that the console has a Gigabyte Heat-sink



ONLY THIS TYPE OF HEAT-SINK REQUIRES THE BRACKET

Avolites Ltd. Engineering Change Notice

Fit the bracket over the pegs of the heat-sink/fan assembly and press down Make sure that the Heat-sink stays in contact with the CPU. If the heat-sink has to be tilted in **any** way to engage the bracket it is not placed correctly. Un-clip the Heat sink clamps and reposition. Refit the heat-sink clamps



Fit two M3x10 screws with flat and spring washers to the back



Switch on the console and check that the fan runs free Close the console and tighten the Dzus screws.

This concludes this ECN