

Avolites Ltd. Engineering Change Notice


Title	Rack Splitter DMX Termination modifications.
ECN Number	ECN-0113
Equipment	IOA 3200A pcb
Author	Alwyn Fernandes
Drawing Number	
Date	7 th December 1999

Reason for ECN	Stop data leds coming on when no DMX cable is present.
Special Parts required	Two 100K resistors and twp strips of dimmer tape
Special Tools required	Soldering iron



Work Required

Two termination resistors (100K) have to be fitted to the track side of IC201 (SN75178). These two resistors are fitted across pins 1&8 and pins 4&7

Component Side View

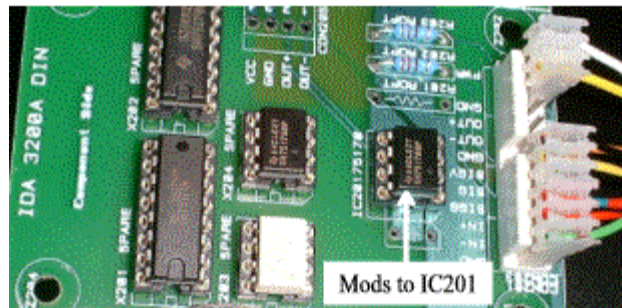

Track Side View

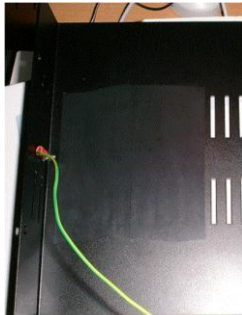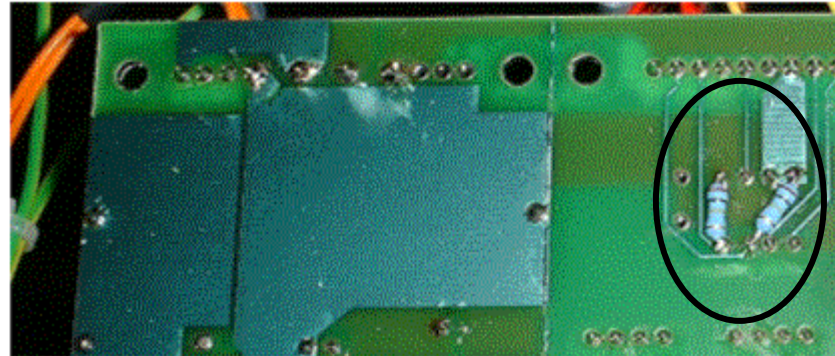

Two strips of dimmer tape are to be fitted to the inside top lid direct above the transformer.